

EXHIBIT B

Est. Event Date	Issue	Where Repaired	Additional Notes	Est. Hrs
10/25/2018	Bleed leak sensor replacement	HACI facility	Crew is reporting a Wing Anti-Ice Fault CAS message. 11/7/2018 Removed and replaced BALD line along left wing spar.	463.7
10/18/2018	Window seals and windshield replacement	HACI facility	10/18/2018 Replaced Cabin Window Seals and LH WindShield.	447.4
9/14/2018	#1 GPS, coax repair	DMFS facility	Customer complained that in flight, ADSB only works on GPS 1. Tightened TNC connector on GPS antenna and tested good.	425.5
6/22/2018	Power Brake Valve replacement	DMFS facility	SB-420-32-001	364.9
1/26/2018	Generator Control Unit's and Trim adapter replacement	HACI facility	01/26/2018 Pilot reports R GEN FAIL CAS message posts after engine start. Removed GCU S/N 0134 & installed S/N 0094. Removed Trim Adapter S/N 1A2000730 & Installed S/N 1A2000850.	216
10/24/2017	Fuel Bladder leaking fuel	HACI facility	10/24/2018 Repaired leak at check valve area.	160.6
9/12/2017	S/N 52 Fuel cap lanyard rivet is missing	HACI facility	09/11/2017 Repair memo sent to Dealer. 10/24/2018 Replaced Rivet.	123.3
9/7/2017	S/N 52 Hydraulic Level at 35%	UNK	Pilot Kevin Tyler reported from Sky Service Calgary that he requested hydraulic replenishment which they could not perform due to lack of hydraulic adaptor for HondaJet. It is not clear where the work was finally accomplished.	87
8/2/2017	Air Conditioning Compressor replacement	DMFS facility	08/02/2017 DMFS removed and replaced the Compressor Drive Module Assy	64
6/22/2017	S/N 52 Velcro on Visor not holding	DMFS facility	06/22/2017 BR Contacted customer for a schedule and date to fix issue at DMFS 08/01/ 2017. 08/02/2017 Removed and replaced the Velcro.	61.1
6/10/2017	Engine Bleed Air Valve replacement	DMFS travelled to Mount Home to perform repair	HPRSOV replaced on-site. Engine runs completed. ACFT RTS.	47.5
5/5/2017	S/N 52 Paint Chipping	HACI facility	04/25/2017 Owner Rob Finley Reported paint chipping at the lower leading edge of the engine pylon. 05/10/2017 Touched up paint chipping at the lower leading edge of the engine pylon. 05/15/2017 Honda credited Mr. Finley's account \$11,000 for @ \$1100.00 an hour for 10 hours for his relocation goodwill.	30.6
4/17/2017	S/N 52 Rad/Alt Fail	HACI facility	05/10/2018 Replaced the Rad-Alt R/T with a new unit. Performed calibration and tested with no observed problems.	8.7
4/17/2017	S/N 52 Multiple CAS Messages	HACI facility	04/17/2018 A/C had multiple CAS messages related to a L gen Fault. Removed and replaced #1 DCU Ops check good.	
3/30/2017	S/N 52 Delivery Receipt & PDCs	HACI facility	Aircraft Delivery at GSO	

Exhibit B